

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
ABARTH											
ABARTH	124 SPIDER	NF	06/2016	06/2018	A (AB-2)						433MHZ
ABARTH	4A GRANDE PUNTO	199	2007	2010	A						433MHZ
ABARTH	4B PUNTO EVO	199	2010	2012	A (AB-1)						433MHZ
ABARTH	81 NUOVA PUNTO	199	2012	2013	A						433MHZ
ALFA ROMEO											
ALFA ROMEO	159(X3)	939	2005	2011							433MHZ
ALFA ROMEO	159(X9)	939	2008	2010			2				433MHZ
ALFA ROMEO	4C	960/961	01/2013	06/2018					Y		433MHZ
ALFA ROMEO	8C	920	2007	2009	S					Cannot program new sensor	433MHZ
ALFA ROMEO	BRERA	939	2005	2010			2				433MHZ
ALFA ROMEO	GIULIA	952	06/2016	06/2018	A (AR-4)						433MHZ
ALFA ROMEO	GIULIETTA	940	01/2014	06/2018					Y		433MHZ
ALFA ROMEO	MITO	955	01/2008	07/2013			2				433MHZ
ALFA ROMEO	MITO	955	08/2013	06/2018			2		Y		433MHZ
ALFA ROMEO	SPIDER	939	2006	2010							433MHZ
ALFA ROMEO	STELVIO	949	01/2017	06/2018	A (AR-4)						433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
ALPINA											
ALPINA	3	E90/E91/E92	03/2007	09/2009	A						433MHZ
ALPINA	3	E90	09/2009	12/2012	A (AL-1)				Y		433MHZ
ALPINA	3	F30	01/2013	06/2018	A (AL-1)						433MHZ
ALPINA	4	F32/F33/F36	03/2014	06/2018	A (AL-1)						433MHZ
ALPINA	5	F10	01/2010	02/2014	A (AL-1)				Y		433MHZ
ALPINA	5	F10	03/2014	01/2017	A (AL-1)		2		Y		433MHZ
ALPINA	5	G30	02/2017	06/2018	A (AL-1)						433MHZ
ALPINA	6	E63	03/2006	11/2010	A (AL-1)						433MHZ
ALPINA	6	F12	12/2010	02/2014	A (AL-1)				Y		433MHZ
ALPINA	6	F12	03/2014	06/2018	A (AL-1)				Y		433MHZ
ALPINA	7	F01	09/2010	12/2015	A (AL-1)				Y		433MHZ
ALPINA	7	G11	01/2016	06/2018	A(AL-1)						433MHZ
ALPINA	XD3	F25	03/2014	06/2018	A (BM-7)				Y		433MHZ
ASTON MARTIN											
ASTON MARTIN	DB9		2005	2009	See AS-2						433MHZ
ASTON MARTIN	DB9	DB9	2010	2015	A (AS-1)						433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
ASTON MARTIN	DB11	DB	06/2016	06/2018	A (AS-3)				Y		433MHZ
ASTON MARTIN	DBS	DBS	2012	2014	A (AS-1)					Cannot program new sensor	433MHZ
ASTON MARTIN	RAPIDE	RAPIDE	2012	2015	A (AS-1)					Cannot program new sensor	433MHZ
ASTON MARTIN	V12 VANTAGE	Vantage V12	2012	2013	A (AS-1)						433MHZ
ASTON MARTIN	V12 ZAGATO	Zagato V12	09/2012	12/2015							433MHZ
ASTON MARTIN	V8 VANTAGE	Vantage V8	01/2012	06/2014	A (AS-1)						433MHZ
ASTON MARTIN	V8 VANTAGE S	Vantage V8 S	01/2013	06/2014	A (AS-1)						433MHZ
ASTON MARTIN	VANQUISH	Vanquish	2012	2015	A (AS-1)					Cannot program new sensor	433MHZ
AUDI											
AUDI	A3	8V	06/2012	12/2015	A				Y		433MHZ
AUDI	A4/S4/AVANT/QUATT	B7	11/2004	10/2007	A (AU-2)						433MHZ
AUDI	A4 CABRIO	B7	11/2004	07/2008	A (AU-2)		2				433MHZ
AUDI	A6 ALLROAD	4B	04/2000	08/2005	A (AU-3)					Cannot program new sensor	433MHZ
AUDI	A6 ALLROAD	4F (C6)	09/2005	12/2011	A (AU-2)						433MHZ
AUDI	A6 ALLROAD	4G	01/2012	06/2018	A						433MHZ
AUDI	A6	4F (C6)	05/2004	05/2009	A (AU-2)		2				433MHZ
AUDI	A6	4F	06/2009	12/2010	A (AU-2)						433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
AUDI	A6	4G	2011	2015	A (AU-2)		2		Y		433MHZ
AUDI	A7	4G	09/2010	06/2018	A (AU-2)				Y		433MHZ
AUDI	A7(RS7)	4G	2013	2015	A						433MHZ
AUDI	A8	4D(D2)	1999	2001	A (AU-3)		2			Cannot program new sensor	433MHZ
AUDI	A8	4E	01/2002	12/2009	A (AU-3)						433MHZ
AUDI	A8	4H	01/2010	10/2017	A (AU-4)						433MHZ
AUDI	A8	D5	11/2017	12/2018	A (AU-2)				Y		433MHZ
AUDI	Q3	8U	07/2011	06/2018	A		1		Y		433MHZ
AUDI	Q5	8R FY	09/2008 06/2017	05/2017 06/2018	A (AR-3)		2		Y		433MHZ
AUDI	Q7	4L	11/2005	05/2015	A(AU-2)		2				433MHZ
AUDI	Q7	4L	06/2015	06/2018	A				Y		433MHZ
AUDI	R8	42	05/2007	06/2009	A (AU-3)						433MHZ
AUDI	R8	42	07/2009	03/2015	A (AU-2)						433MHZ
AUDI	R8	4S	04/2015	06/2018	A (AU-6)						433MHZ
AUDI	RS6/RS6 PLUS	4B	2002	2004	A (AU-3)					Cannot program new sensor	433MHZ
AUDI	RS6/RS6 PLUS	4F	2008	2010	A (AU-3)						433MHZ
AUDI	RS6/RS6 PLUS	4G	01/2013	11/2017	A (AU-3)						433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
AUDI	RS3	8V	06/2017	06/2018	A				Y		433MHZ
AUDI	RS4	8E(B7)	05/2006	02/2009	A (AU-2)						433MHZ
AUDI	S8	4D(D2)/4E(D3)	09/1999	10/2009	A (AU-3)		8			Cannot program new sensor	433MHZ
AUDI	S8	4H(D4)	11/2009	10/2017	A (AU-3)						433MHZ
AUDI	S8	D5	11/2017	06/2018	A (AU-2)				Y		433MHZ
AUDI	TT(Q5)	8S	02/2014	06/2018	A (AU-2)				Y		433MHZ
BENTLEY											
BENTLEY	AZURE	RBS	01/2007	06/2017	A (BE-1)						433MHZ
BENTLEY	CONTINENTAL FLYING		04/2005	06/2018	A (BE-1)						433MHZ
BENTLEY	CONTINENTAL GT		09/2003	05/2005	A (BE-1)					Cannot program new sensor	433MHZ
BENTLEY	CONTINENTAL GT		06/2005	03/2018	A (BE-1)						433MHZ
BENTLEY	MULSANNE		01/2011	06/2018	A (BE-1)						433MHZ
BMW											
BMW	1 SERIES	E87/E81	12/2006	08/2010	A		2				433MHZ
BMW	1 SERIES	E81/E82/E88	09/2010	02/2013	A (BM-1)				Y		433MHZ
BMW	1 SERIES	F20/F21	03/2014	06/2018	A (BM-1)		3				433MHZ
BMW	2 SERIES	F22/F23/F45	03/2014	06/2018	A (BM-1)		2				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
BMW	3 SERIES	E46/M3	03/1999	12/2004	A (BM-1)		2				433MHZ
BMW	3 SERIES	E90/E91/E92/E93	06/2006	08/2009	A (BM-1)		2				433MHZ
BMW	3 SERIES	E90/E91/E92/E93	09/2009	09/2011	A (BM-1)		2		Y		433MHZ
BMW	3 SERIES	F30/F31/F34/ F35/F80	03/2014	06/2018	A (BM-2)		2				433MHZ
BMW	4 SERIES	F32/F33/F36	03/2014	06/2018	A (BM-1)						433MHZ
BMW	5 SERIES	E39	09/1998	07/2003	A (BM-1)		2				433MHZ
BMW	5 SERIES	E60/E61	03/2006	08/2010	A		2				433MHZ
BMW	5 SERIES	F07/F10/F11	09/2010	02/2014	A (BM-1)		2		Y		433MHZ
BMW	5 SERIES	F07/F10/F11	03/2014	01/2017	A (BM-1)		2		Y		433MHZ
BMW	5 SERIES	G30/G31	02/2017	06/2018	A (BM-6)						433MHZ
BMW	6 SERIES	E63/E64	03/2006	12/2009	A (BM-1)		2				433MHZ
BMW	6 SERIES	F06/F12/F13	03/2011	02/2014	A (BM-1)				Y		433MHZ
BMW	6 SERIES	F06/F12/F13	03/2014	06/2018	A (BM-1)				Y		433MHZ
BMW	6 SERIES GT	G32	11/2017	12/2018	A (BM-1)						433MHZ
BMW	7 SERIES	E38	09/1998	11/2003	A (BM-1)						433MHZ
BMW	7 SERIES	E65/E66	03/2006	08/2010	A						433MHZ
BMW	7 SERIES	F01	09/2010	02/2014	A (BM-1)				Y		433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
BMW	7 SERIES	F01/F02	03/2014	05/2015	A (BM-1)				Y		433MHZ
BMW	7 SERIES	G11/G12	06/2015	06/2018	A (BM-1)						433MHZ
BMW	I3	I01	09/2013	06/2018	A (BM-1)		2				433MHZ
BMW	I8	I12	11/2013	06/2018	A (BM-1)						433MHZ
BMW	X1	E84	10/2009	02/2014	A		2		Y		433MHZ
BMW	X1	E84	03/2014	09/2015	A (BM-1)		2		Y		433MHZ
BMW	X1	F48	10/2015	06/2018	A (BM-1)						433MHZ
BMW	X3	E83	03/2003	08/2010	A		2				433MHZ
BMW	X3	F25	11/2010	02/2014	A (BM-1)				Y		433MHZ
BMW	X3	F25	03/2014	07/2017	A (BM-7)				Y		433MHZ
BMW	X3	G01	08/2017	06/2018	A						433MHZ
BMW	X4	F26	04/2014	06/2018	A (BM-1)				Y		433MHZ
BMW	X5	E53	10/1999	09/2006	A (BM-1)		2			Cannot program new sensor	433MHZ
BMW	X5	E70	11/2006	12/2010	A						433MHZ
BMW	X5	E70	01/2011	06/2013	A (BM-1)				Y		433MHZ
BMW	X5	F15	07/2013	06/2018	A (BM-6)						433MHZ
BMW	X6	E71	12/2007	10/2011	A		2				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
BMW	X6	E71	12/2011	07/2014	A (BM-1)		2		Y		433MHZ
BMW	X6	F16	08/2014	06/2018	A (BM-1)						433MHZ
BMW	Z4	E85/E86/E89	03/2006	08/2010	A (BM-1)		2				433MHZ
BMW	Z4	E85/E86/E89	09/2010	02/2014	A (BM-1)				Y		433MHZ
BMW	Z4	E89	03/2014	03/2018	A (BM-1)				Y		433MHZ
BUICK											
BUICK	PARK AVENUE	PARK AVENUE	1997	2005	S (BU-1)						433MHZ
CADILLAC											
CADILLAC	ATS	ATS	2012	2015	S (CD-1)						433MHZ
CADILLAC	ATS-V		01/2016	06/2018	S (CD-1)						433MHZ
CADILLAC	CTS	GMX322	2006	2007	S (CD-3)						433MHZ
CADILLAC	CTS	GMX206/GMX226	01/2008	06/2018	S (CD-3)		2				433MHZ
CADILLAC	ESCALADE	GMT900/GMT K2XL	01/2012	06/2018	S (CD-5)		2				433MHZ
CADILLAC	SRX	GMT265	2005	2006	S (CD-6)						433MHZ
CADILLAC	STS	GMX295	2005	2008	S (CD-3)						433MHZ
CADILLAC	XLR		2004	2009	S (CD-6)						433MHZ
CHEVROLET											

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
CHEVROLET	AVEO	T300	11/2010	06/2018			2				433MHZ
CHEVROLET	CAMARO	GMX521	2012	2015	S (CV-1)						433MHZ
CHEVROLET	CAMARO	1AG37	01/2016	06/2018	S (CV-1)						433MHZ
CHEVROLET	CAPTIVA	C100	06/2006	06/2018	S (CV-4)		2				433MHZ
CHEVROLET	COBALT	G1LC	02/2013	12/2015							433MHZ
CHEVROLET	CORVETTE C5		1997	2000	S						433MHZ
CHEVROLET	CORVETTE	GMX245	07/2004	01/2010	S (CV-4)						433MHZ
CHEVROLET	CORVETTE	GMX245	01/2010	01/2013	S (CV-4)						433MHZ
CHEVROLET	CORVETTE	C7	01/2014	06/2018					Y		433MHZ
CHEVROLET	CRUZE	KL1J	06/2014	06/2018	S (CV-3)		2				433MHZ
CHEVROLET	EXPRESS	GMT610	07/2002	06/2018	S (CV-5)						433MHZ
CHEVROLET	MALIBU	KL1G	01/2012	06/2018	S		2				433MHZ
CHEVROLET	MATIZ	M100 M400	06/2014 01/2015	12/2014 06/2018	O (CV-9)						433MHZ
CHEVROLET	ORLANDO	J309	09/2010	06/2018	S (CV-1)		2				433MHZ
CHEVROLET	SPARK	M1JC	07/2009	06/2018	O (CV-9)		2				433MHZ
CHEVROLET	SUBURBAN	GMT931	03/2006	07/2008	S (CV-8)						433MHZ
CHEVROLET	TRAX	G1UC	01/2013	06/2018	S (CV-3)		2				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
CHEVROLET	TRAILBLAZER	GMT360	2007	2008	S (CV-8)						433MHZ
CHEVROLET	VOLT	D1JCI	2012	2014	S (CV-7)		2		Y		433MHZ
CHRYSLER											
CHRYSLER	300	LX	01/2009	11/2017	O				Y		433MHZ
CHRYSLER	300C	LX	06/2006	05/2010	O		1				433MHZ
CHRYSLER	SEBRING	JS	06/2006	12/2015	O						433MHZ
CHRYSLER	TOWN-COUNTRY	RT	01/2011	12/2016	O				Y		433MHZ
CHRYSLER	VIPER		12/2012	06/2018					Y		433MHZ
CHRYSLER	VOYAGER	RT	07/2007	12/2010							433MHZ
CHRYSLER	VOYAGER	RT	01/2011	12/2016			2		Y		433MHZ
CITROEN											
CITROEN	BERLINGO	B9	01/2009	10/2013	O (CI-1)	Y	3				433MHZ
CITROEN	BERLINGO	B9	10/2013	06/2018	O (CI-1)	Y	3				433MHZ
CITROEN	C-CACTUS/C4-CACTUS	E3	07/2014	12/2016	O (CI-1)	Y	2				433MHZ
CITROEN	C-ELYSEE	M3/M4	10/2012	06/2018	O (CI-1)	Y					433MHZ
CITROEN	C4	L	11/2004	07/2008	O (CI-1)	Y	8				433MHZ
CITROEN	C4	L/N	08/2008	09/2013	O (CI-1)	Y	8				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
CITROEN	C4	N	10/2013	06/2018	O (CI-1)	Y	8				433MHZ
CITROEN	C4 AIRCROSS	B	06/2014	03/2018	O (CI-5)	Y	2				433MHZ
CITROEN	C5	DC/DE	03/2001	07/2004	O (CI-1)	Y	2				433MHZ
CITROEN	C5	RC/RE RD/TD	08/2004 01/2009	12/2008 10/2013	O (CI-1)	Y	2				433MHZ
CITROEN	C5	RD/TD	11/2013	11/2017	O (CI-1)	Y	2				433MHZ
CITROEN	C6	T	09/2005	05/2013	O (CI-1)	Y	8				433MHZ
CITROEN	C8	E	06/2002	09/2005	S		8				433MHZ
CITROEN	C8	E	10/2005	11/2010	O (CI-1)	Y	8				433MHZ
CITROEN	C8	E	06/2014	06/2015		Y					433MHZ
CITROEN	C-ZERO	1	10/2014	06/2018	O (CI-5)	Y	1				433MHZ
CITROEN	DS4	N	12/2010	12/2013	O (CI-1)	Y	8				433MHZ
CITROEN	DS4	N	01/2014	06/2018	O (CI-1)	Y	8				433MHZ
CITROEN	DS5	K	01/2011	12/2013	O (CI-1)	Y	8				433MHZ
CITROEN	DS5	K	01/2014	06/2018	O (CI-1)	Y	8				433MHZ
CITROEN	JUMPY/DISPATCH	X	01/2011	09/2014	O (CI-1)	Y	1				433MHZ
CITROEN	JUMPY/DISPATCH	X	10/2014	04/2016	A/O (CI-1)	Y	1				433MHZ
CITROEN	JUMPER/RELAY(Bus)	250	06/2014	12/2016	O (CI-1)	Y	2				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
CITROEN	JUMPER/RELAY(VAN)	250	06/2014	06/2018	A (CI-4)		2		Y		433MHZ
CITROEN	NEMO	A	10/2007	12/2015	A (CI-4)		2		Y		433MHZ
DACIA											
DACIA	DOKKER	SD	01/2014	06/2018	A (DA-2)/O (DA-1)	Y	2				433MHZ
DACIA	DUSTER	SD	02/2010	06/2018	A (DA-2)/O (DA-1)	Y	9				433MHZ
DACIA	LODGY	SD	01/2012	06/2018	A (DA-2)/O (DA-1)	Y	2				433MHZ
DACIA	LOGAN	SD	11/2012	06/2018	A (DA-2)/O (DA-1)	Y	9				433MHZ
DACIA	SANDERO(PRO)	SD	10/2012	06/2018	A (DA-1)/O (DA-1)	Y	9				433MHZ
DAEWOO											
DAEWOO	GENTRA	J200	08/2013	12/2016							433MHZ
DAEWOO	NEXIA	T-CAR	06/2014	12/2016							433MHZ
DODGE											
DODGE	AVENGER	JS	2006	2007	A						433MHZ
DODGE	CALIBER	PK	01/2006	12/2011	O (DG-1)/ A (DG-2)		2				433MHZ
DODGE	CHALLENGER	LC22	01/2008	06/2018	O (DG-1)				Y		433MHZ
DODGE	CHARGER	LX48D/LD	01/2009	06/2018	O (DG-1)				Y		433MHZ
DODGE	DAKOTA		2009	2014	O (DG-1)						433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
DODGE	DURANGO	WD75	01/2011	06/2018	O (DG-1)				Y		433MHZ
DODGE	GRAND CARAVAN		01/2011	12/2016	O (DG-1)				Y		433MHZ
DODGE	JOURNEY	JC49	01/2009	12/2010	O (DG-1)		1				433MHZ
DODGE	JOURNEY	JC	01/2011	06/2018	O (DG-1)				Y		433MHZ
DODGE	NITRO	KJ	08/2006	12/2011	O (DG-1)						433MHZ
DODGE	RAM SERIES	DS/DJ	2010	2013	O (DG-1)				Y		433MHZ
DODGE	RAM SERIES	DS/DJ	01/2014	06/2018	A						433MHZ
DODGE	VIPER	ZD	12/2012	06/2015	O (DG-1)				Y		433MHZ
FERRARI											
FERRARI	CALIFORNIA	F149	10/2008	11/2017	A (FE-1)						433MHZ
FERRARI	550 MARANELLO	F133	06/1997	12/2001	A (FE-1)					Cannot program new sensor	433MHZ
FERRARI	575 M-MARANELLO		09/2002	02/2006	A (FE-1)					Cannot program new sensor	433MHZ
FERRARI	ENZO	F140	01/2003	11/2006	A (FE-1)					Cannot program new sensor	433MHZ
FERRARI	612 SCAGLIETTI	F137	03/2004	01/2011	A (FE-1)					Cannot program new sensor	433MHZ
FERRARI	599 GTB (F141)	F141	04/2006	06/2012	A (FE-1)					Cannot program new sensor	433MHZ
FERRARI	F12 BERLINETTA	F152	10/2012	12/2014	A (FE-1)						433MHZ
FERRARI	458 ITALIA	F142	09/2007	12/2015	A (FE-1)						433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
FERRARI	F430	F131E	07/2007	10/2009	A (FE-1)						433MHZ
FERRARI	FF	F151	06/2011	12/2016	A (FE-1)						433MHZ
FERRARI	FXX	F140	07/2005	03/2006	A (FE-1)					Cannot program new sensor	433MHZ
FERRARI	LAFERRARI	F150	12/2013	06/2018	A (FE-1)						433MHZ
FIAT											
FIAT	124 SPIDER	NF	06/2016	06/2018	A (FI-2)						433MHZ
FIAT	500L	312/330	05/2007	06/2018	A (FI-1)/O (FI-5)		2		Y		433MHZ
FIAT	BRAVO	198	01/2007	09/2014			2				433MHZ
FIAT	DOBLO	223	12/2012	06/2018	A (FI-2)				Y		433MHZ
FIAT	DUCATO	250	06/2014	06/2018	A (FI-2)		2		Y		433MHZ
FIAT	FREEMONT	JF	01/2011	06/2018	A (FI-2)/O (FI-5)	Y	1		Y		433MHZ
FIAT	FULLBACK	KT0T	09/2016	06/2018							433MHZ
FIAT	GRANDE PUNTO	199	01/2012	03/2015							433MHZ
FIAT	LINEA	323	03/2007	12/2015	A (FI-2)		2		Y		433MHZ
FIAT	PUNTO	199	09/2005	06/2018			2				433MHZ
FIAT	PUNTO EVO	199	2009	2012			2				433MHZ
FIAT	QUBO	225	10/2007	06/2018	A (FI-2)		2		Y		433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
FIAT	SCUDO	3H	10/2014	04/2016	A		1				433MHZ
FIAT	STRADA	178	01/2012	06/2018	A (FI-4)				Y		433MHZ
FIAT	TALENTO	FJL	06/2016	06/2018	O (FI-5)	Y	2				433MHZ
FIAT	ULYSSE	179	06/2002	09/2005	O (FI-5)		1				433MHZ
FIAT	ULYSSE NUOVO 2F	179	10/2005	10/2010	O (FI-5)						433MHZ
FORD											
FORD	B-MAX	CB2	06/2014	10/2017	S (FO-2)		2				433MHZ
FORD	C-MAX	CB7/CEU	04/2014	06/2018	S (FO-2)		2				433MHZ
FORD	ECOSPORT	CBW	01/2013	06/2018	S (FO-2)						433MHZ
FORD	EDGE	CDQ	01/2015	06/2018	S (FO-2)						433MHZ
FORD	EXPLORER	TWJ	01/2013	12/2017	S (FO-2)						433MHZ
FORD	FIESTA	CCN	05/2014	05/2017	S (FO-2)		2				433MHZ
FORD	FIESTA	CE1	06/2017	06/2018	A (FO-6)/S (FO-2)						433MHZ
FORD	FIESTA ST	CCN	05/2014	05/2017	S (FO-2)		2				433MHZ
FORD	FIESTA ST	CE1	06/2017	06/2018	A (FO-6)/S (FO-2)						433MHZ
FORD	FOCUS	CEW	05/2014	06/2018	S (FO-2)		2				433MHZ
FORD	FOCUS RS	CEW	08/2015	06/2018	S (FO-2)		2				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
FORD	FOCUS ST	CEW	05/2014	06/2018	S (FO-2)		2				433MHZ
FORD	GALAXY	CA1	01/2006	12/2014	A (FO-5)		2				433MHZ
FORD	GALAXY	CDR	01/2015	06/2018	S (FO-2)		2				433MHZ
FORD	KA+	KAF	11/2016	06/2018	S (FO-2)						433MHZ
FORD	KUGA	CBS	05/2014	06/2018	S (FO-2)		2				433MHZ
FORD	MONDEO	CA2	01/2007	09/2014	A (FO-5)		2				433MHZ
FORD	MONDEO	CNG	10/2014	09/2017	A (FO-1)						433MHZ
FORD	MONDEO	CNG	10/2017	06/2018	A (FO-1)						433MHZ
FORD	MUSTANG	CZG	01/2015	06/2018	A (FO-1)						433MHZ
FORD	NAVIGATOR	Fa0114	01/2011	12/2014	S (FO-2)						433MHZ
FORD	RANGER	TKE	09/2015	06/2018			2				433MHZ
FORD	S-MAX	CA1	01/2006	12/2014	A (FO-5)/O (FO-3)	Y	5				433MHZ
FORD	S-MAX	CDR	01/2015	06/2018	S (FO-2)		2				433MHZ
FORD	TOURNEO CONNECT	CHC	01/2014	06/2018	S (FO-2)						433MHZ
FORD	TOURNEO COURIER	C4A	01/2014	06/2018	S (FO-2)						433MHZ
FORD	TOURNEO CUSTOM	TTF	04/2013	06/2018	S (FO-2)	Y					433MHZ
FORD	TRANSIT	TTG	01/2014	11/2017	S (FO-2)						433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
HOLDEN											
HOLDEN	WM CAPRICE	WM	2007	2012							433MHZ
HONDA											
HONDA	ACCORD#	2GA/2GB/QE	01/2014	10/2017	O (HO-1)		2			Use Wireless/Snap-In Sensor	433MHZ
HONDA	JAZZ#	GK	11/2014	06/2018	O (HO-1)					Use Wireless/Snap-In Sensor	433MHZ
HONDA	NSX#	NC	11/2016	06/2018	O (HO-1)						433MHZ
HSV											
HSV	Clubsport GXP		01/2010	12/2010							433MHZ
HSV	GRANGE	Hr0078	2007	2012							433MHZ
HSV	GTS	HT0078	2007	2012							433MHZ
HSV	MALOO GXP		01/2010	12/2010							433MHZ
HSV	R8 CLUBSPORT		2007	2012							433MHZ
HSV	R8 MALOO		2008	2012							433MHZ
HSV	SENATOR	He0078	2007	2012							433MHZ
HYUNDAI											
HYUNDAI	ACCENT	RB	03/2014	11/2017	O (HD-1)	Y	2				433MHZ
HYUNDAI	AZERA 11/GRANDEUR	HG	01/2011	06/2016	O (HD-1)	Y					433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
HYUNDAI	ELANTRA	MD	01/2014	10/2015	O (HD-1)	Y					433MHZ
HYUNDAI	ELANTRA	AD	11/2015	06/2018	O (HD-1)	Y					433MHZ
HYUNDAI	GENESIS	DH	01/2014	11/2017	O (HD-1)	Y					433MHZ
HYUNDAI	GRAND SANTA FE	DM	04/2013	06/2018	A/O (HD-1)	Y					433MHZ
HYUNDAI	H-1/I800/H300	TQ	03/2014	06/2018	O (HD-1)	Y	2				433MHZ
HYUNDAI	I10	IA	11/2013	06/2018	A (HD-2)/O (HD-1)	Y	1				433MHZ
HYUNDAI	I20(PB)	PB F/L	09/2008	05/2014	A/O (HD-1)	Y	2				433MHZ
HYUNDAI	I20(PB)	PB F/L	06/2014	10/2014	A (HD-2)/O (HD-1)	Y	2				433MHZ
HYUNDAI	I20(GB)	GB	11/2014	06/2018	A (HD-2)/O (HD-1)	Y	2				433MHZ
HYUNDAI	IX20	JC	01/2010	09/2013	A/O (HD-1)	Y	2				433MHZ
HYUNDAI	IX20	JC	10/2013	03/2017	A/O (HD-1)	Y	2				433MHZ
HYUNDAI	IX20	JC	04/2017	06/2018	A/O (HD-1)	Y					433MHZ
HYUNDAI	I30	FD CW	01/2007 01/2009	02/2012 02/2012	A/O (HD-1)	Y	2				433MHZ
HYUNDAI	I30	GD	03/2012	03/2014	A/O (HD-1)	Y	2				433MHZ
HYUNDAI	I30(GD)	GD	04/2014	03/2017	A/O (HD-1)	Y	2				433MHZ
HYUNDAI	I30(GD)	GD	04/2017	05/2017	A/O (HD-1)	Y	2				433MHZ
HYUNDAI	I30(PD)	PD	01/2017	06/2018	A (HD-2)		2				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
HYUNDAI	I30 N	PD	11/2017	12/2018	A		2				433MHZ
HYUNDAI	I40	VF	01/2011	03/2014	A/O (HD-1)	Y	2				433MHZ
HYUNDAI	I40	VF	04/2014	12/2017	A/O (HD-1)	Y	2				433MHZ
HYUNDAI	IONIQ	BEV	10/2016	06/2018	A (HD-2)						433MHZ
HYUNDAI	IX35(HI)	EL/ELH	01/2013	09/2015	A/O (HD-1)	Y	2				433MHZ
HYUNDAI	IX35(LO)	EL	01/2010	12/2012	A/O (HD-1)	Y	2				433MHZ
HYUNDAI	IX35(LO)	EL/ELH	01/2013	09/2015	A/O (HD-1)	Y	2				433MHZ
HYUNDAI	IX35 FUEL CELL	EL	01/2013	06/2018	O (HD-1)	Y					433MHZ
HYUNDAI	IX55	EN	12/2008	01/2012	O (HD-1)	Y	1				433MHZ
HYUNDAI	KONA	OS	11/2017	12/2018	A (KA-2)/O						433MHZ
HYUNDAI	SANTA FE	CM	01/2009	05/2012	O (HD-1)	Y	1				433MHZ
HYUNDAI	SANTA FE	DM	06/2012	03/2013	O (HD-1)	Y	2				433MHZ
HYUNDAI	SANTA FE	DM	04/2013	03/2017	O (HD-1)	Y	2				433MHZ
HYUNDAI	SANTA FE	DM	04/2017	06/2018	A/O (HD-1)	Y					433MHZ
HYUNDAI	TUCSON	TL/TLE	10/2015	06/2018	A (HD-2)/O (HD-1)	Y	2				433MHZ
HYUNDAI	VELOSTER	FS	03/2011	06/2018	O (HD-1)	Y	2				433MHZ
HUMMER											

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
HUMMER	H2	H28	04/2002	12/2008	S (HM-1)		2				433MHZ
HUMMER	H3	H38	03/2005	01/2012	S (HM-2)						433MHZ
INFINITI											
INFINITI	EX SERIES	J50	01/2008	03/2014	O (IF-1)						433MHZ
INFINITI	FX	S51	03/2008	12/2013	O (IF-1)	Y					433MHZ
INFINITI	G37 COUPE/SEDAN	CV36	06/2008	02/2014	O (IF-1)		1				433MHZ
INFINITI	M SERIES	Y51	05/2010	03/2014	A (IF-2)						433MHZ
INFINITI	Q30	H15	12/2015	06/2018	A (IF-2)		2		Y		433MHZ
INFINITI	Q50	V37	06/2013	06/2018	O (IF-1)	Y					433MHZ
INFINITI	Q60	CV36	03/2014	06/2016	O (IF-1)	Y					433MHZ
INFINITI	Q70	Y51	05/2014	06/2018	O (IF-1)						433MHZ
INFINITI	QX30	H15	06/2016	06/2018	A (IF-2)		2		Y		433MHZ
INFINITI	QX50	J50	04/2014	06/2018	O (IF-1)						433MHZ
INFINITI	QX70	S51	04/2014	06/2018	O (IF-1)/A(IF-3)	Y					433MHZ
JAGUAR											
JAGUAR	F-PACE	X761	04/2016	06/2018	A (JG-1)						433MHZ
JAGUAR	F-TYPE	X152	03/2013	12/2015	A (JG-1)						433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
JAGUAR	F-TYPE	F 52	01/2016	06/2018	A (JG-1)						433MHZ
JAGUAR	S-TYPE	CCX	03/1999	10/2007	A (JG-1)		3				433MHZ
JAGUAR	XE	X760	02/2015	06/2018	A(JG-1)						433MHZ
JAGUAR	XF	X250	01/2007	09/2015	A (JG-1)						433MHZ
JAGUAR	XF	X260	10/2015	06/2018	A (JG-1)						433MHZ
JAGUAR	XJ	X350	2004	2009	A (JG-1)		3				433MHZ
JAGUAR	XJ	X351	01/2010	06/2018	A (JG-1)						433MHZ
JAGUAR	XK	X150	2006	2015	A (JG-1)						433MHZ
JAGUAR	X-TYPE	X400	2007	2015	A (JG-1)						433MHZ
JEEP											
JEEP	COMMANDER	XK	01/2006	12/2010	O (JE-1)						433MHZ
JEEP	COMPASS	MK	01/2011	06/2016	A (JE-2)		2				433MHZ
JEEP	COMPASS	MP/MX	07/2017	06/2018	A (JE-2)/ O (JE-1)	Y					433MHZ
JEEP	CHEROKEE	KK	2007	2013	A						433MHZ
JEEP	CHEROKEE	KL	01/2014	06/2018	A (JE-3)/O (JE-1)	Y	2				433MHZ
JEEP	GRAND CHEROKEE	WH	06/2006	12/2010	A (JE-2)/O (JE-1)						433MHZ
JEEP	GRAND CHEROKEE	WK2	01/2011	12/2015	A/O (JE-1)	Y	2		Y		433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
JEEP	GRAND CHEROKEE	WK2	01/2016	06/2018	A (JE-2)/ O (JE-1)	Y					433MHZ
JEEP	LIBERTY	KK	2010	2014	A (JE-2)						433MHZ
JEEP	PATRIOT	MK	12/2006	03/2017	A (JE-2)		2				433MHZ
JEEP	RENEGADE	BU	01/2015	06/2018	A (JE-2)/O (JE-1)	Y	2				433MHZ
JEEP	WRANGLER	JK	07/2007	08/2010	O (JE-1)						433MHZ
JEEP	WRANGLER	JK	09/2010	06/2018	A/O (JE-1)	Y	1		Y		433MHZ
KIA											
KIA	CARENS	RP	01/2012	06/2018	A/O (KA-1)	Y	1				433MHZ
KIA	CEED - PROCEED (3 door) - (5 door)	ED	07/2009	08/2012	A/O (KA-1)	Y	1				433MHZ
KIA	CEED - PROCEED (3 door) - (5 door)	JD	03/2012	03/2017	A/O (KA-1)	Y	2				433MHZ
KIA	CEED - PROCEED (3 door) - (5 door)	JD	04/2017	06/2018	A/O (HD-1)	Y					433MHZ
KIA	NIRO	DE	07/2016	06/2018	A (KA-2)						433MHZ
KIA	OPTIMA	TF	03/2012	07/2013	A/O (KA-1)	Y					433MHZ
KIA	OPTIMA	TF	08/2013	09/2015	A (KA-2)/O	Y					433MHZ
KIA	OPTIMA	JF	10/2015	06/2018	A (KA-2)/O						433MHZ
KIA	PICANTO	TA	06/2014	03/2017	A/O (KA-1)	Y	2				433MHZ
KIA	RIO	UB	01/2012	06/2014	A/O (KA-1)	Y	1				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
KIA	RIO(LOW LINE)	UB	06/2014	01/2017	A/O (KA-1)	Y	1				433MHZ
KIA	RIO(HIGH LINE)	UB	06/2014	01/2017	A/O (KA-1)	Y	2				433MHZ
KIA	SORENTO	XM	06/2010	06/2012	A/O (KA-1)	Y	2				433MHZ
KIA	SORENTO	XM	07/2012	08/2014	A (KA-2)/O (KA-1)	Y	2				433MHZ
KIA	SORENTO	UM	09/2014	04/2017	A (KA-2)/O (KA-1)	Y	2				433MHZ
KIA	SORENTO	UM	05/2017	06/2018	A/O (HD-1)	Y					433MHZ
KIA	SOUL 1.6 CWT	AM	06/2010	09/2013	A/O (KA-1)	Y	1				433MHZ
KIA	SOUL	PS	10/2013	06/2018	A/O (KA-1)	Y	1				433MHZ
KIA	SPORTAGE	SL/SLS	01/2014	01/2016	A/O (KA-1)	Y	1				433MHZ
KIA	SPORTAGE	QL/QLE	02/2016	06/2018	A (KA-2)/O (KA-1)	Y	1				433MHZ
KIA	SPORTAGE(LOW LINE)	SL	2012	2013	A (KA-2)/O (KA-1)	Y	1				433MHZ
KIA	SPORTAGE (HIGH LINE)	SL	2010	2013	A (KA-2)/O (KA-1)	Y	1				433MHZ
KIA	STINGER	CK	10/2017	12/2018	A (KA-2)/ O						433MHZ
KIA	VENGA	YN	06/2010	04/2014	A/O (KA-1)	Y	1				433MHZ
KIA	VENGA	YN	05/2014	03/2017	A/O (KA-1)	Y	1				433MHZ
KIA	VENGA	YN	04/2017	06/2018	A/O (HD-1)	Y					433MHZ
LADA											

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
LADA	GRANTA	2190/2191	09/2012	06/2018			7				433MHZ
LADA	KALINA II	2192/2194	05/2013	06/2018	O (LA-1)	Y	8				433MHZ
LADA	VESTA	GF	02/2017	06/2018	O						433MHZ
LAMBORGHINI											
LAMBORGHINI	AVENTADOR	LB834	05/2011	06/2018	A (LB-1)						433MHZ
LAMBORGHINI	GALLARDO(US)	LB714/LB724	2007	2015	A (LB-1)						433MHZ
LAMBORGHINI	LP640(US)		06/2007	01/2010	A (LB-1)						433MHZ
LAMBORGHINI	MURCIELAGO LP640 (US)	LB824	2006	2015	A (LB-1)						433MHZ
LANCIA											
LANCIA	DELTA	844	01/2008	05/2014			2				433MHZ
LANCIA	FLAVIA	JS	10/2010	12/2013	O (LC-4)						433MHZ
LANCIA	PHEDRA	179	06/2002	09/2005	S						433MHZ
LANCIA	PHEDRA	179	10/2005	12/2010							433MHZ
LANCIA	THEMA	LX	01/2011	06/2018	O (LC-4)		2		Y		433MHZ
LANCIA	VOYAGER		07/2007	12/2010							433MHZ
LANCIA	VOYAGER	RT	01/2011	12/2015	O (LC-3)	Y			Y		433MHZ
LAND ROVER											

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
LAND ROVER	DISCOVERY	Discovery 3 (L319)	2005	2009	A (LR-1)		2				433MHZ
LAND ROVER	DISCOVERY	Discovery 4 (L319)	01/2010	12/2014	A (LR-1)						433MHZ
LAND ROVER	DISCOVERY	Discovery 4 (L319)	01/2015	03/2017	A (LR-1)						433MHZ
LAND ROVER	DISCOVERY	Discovery 5 (L462)	04/2017	12/2018	A (LR-1)						433MHZ
LAND ROVER	DISCOVERY SPORT	L550	03/2015	06/2018	A (LR-1)						433MHZ
LAND ROVER	FREELANDER	Freelander 2 (L359)	2005	2015	A (LR-1)		1				433MHZ
LAND ROVER	RANGE ROVER	L322	03/2002	02/2003	A (LR-1)					Cannot program new sensor	433MHZ
LAND ROVER	RANGE ROVER	L322	2005	2012	A (LR-1)						433MHZ
LAND ROVER	RANGE ROVER	LG/L405	01/2013	06/2018	O						433MHZ
LAND ROVER	RANGE ROVER EVOQUE	L538	07/2011	12/2014	A (LR-1)		2				433MHZ
LAND ROVER	RANGE ROVER EVOQUE	L538	01/2015	06/2018	A (LR-1)		2				433MHZ
LAND ROVER	RANGE ROVER VELAR	L560	09/2017	12/2018	A (LR-1)						433MHZ
LAND ROVER	RANGE ROVER VOGUE		2005	2013	A (LR-1)						433MHZ
LAND ROVER	RANGE ROVER SPORT	L494	06/2014	12/2014	A						433MHZ
LAND ROVER	RANGE ROVER SPORT	L494	01/2015	06/2018	A (LR-1)						433MHZ
LEXUS											
LEXUS	C-CUV#	600A	11/2014	12/2016	O (LX-1)	Y			Y	Use Wireless/Snap-In Sensor	433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
LEXUS	CT#	A10	06/2014	12/2016	O (LX-1)	Y	1			Use Wireless/Snap-In Sensor	433MHZ
LEXUS	ES		2007	2010	O (LX-2)	Y					433MHZ
LEXUS	ES#	XV60	06/2014	06/2018	O (LX-1)	Y			Y	Use Wireless/Snap-In Sensor	433MHZ
LEXUS	GS	S190/L10	01/2005	12/2011	O (LX-2)	Y (Unlock Enable)	1				433MHZ
LEXUS	GS#	L10	01/2012	06/2018	O (LX-1)	Y	1		Y	Use Wireless/Snap-In Sensor	433MHZ
LEXUS	GX	J120	2006	2009	O (LX-2)	Y					433MHZ
LEXUS	GX#	J150	06/2014	06/2018	O (LX-1)	Y			Y	Use Wireless/Snap-In Sensor	433MHZ
LEXUS	IS	XE20	2006	2010	O (LX-2)	Y	1				433MHZ
LEXUS	IS#	XE30	07/2013	06/2018	O (LX-1)	Y	1			Use Wireless/Snap-In Sensor	433MHZ
LEXUS	LFA		2010	2012	O (LX-1)	Y					433MHZ
LEXUS	LS	XF40	08/2006	09/2012	O (LX-1)	Y (Unlock Enable)	1				433MHZ
LEXUS	LS#	XF40	10/2012	11/2017	O (LX-1)	Y			Y	Use Wireless/Snap-In Sensor	433MHZ
LEXUS	LX	J100/J200	2005	2010	O (LX-1)	Y					433MHZ
LEXUS	LX	J200	10/2015	06/2018	O	Y					433MHZ
LEXUS	LX#	J200	06/2014	09/2015	O (LX-1)	Y			Y	Use Wireless/Snap-In Sensor	433MHZ
LEXUS	NX#	AZ10	07/2014	06/2018	O	Y	2		Y	Use Wireless/Snap-In Sensor	433MHZ
LEXUS	RC#	XC1	01/2014	06/2018	O	Y			Y		433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
LEXUS	RX	XU30/AL10	2006	2010	O (LX-1)	Y (Unlock Enable)	1				433MHZ
LEXUS	RX	AL20	11/2015	06/2018	O	Y					433MHZ
LEXUS	RX#	AL10	06/2014	10/2015	O (LX-1)	Y	1			Use Wireless/Snap-In Sensor	433MHZ
LEXUS	SC430	UZZ40	05/2007	06/2010	O (LX-2)	Y					433MHZ
LOTUS											
LOTUS	ELISE	Series 2/3	01/2008	06/2018	A (LT-1)				Y		433MHZ
LOTUS	EVORA	Eagle	01/2010	06/2018	A (LT-1)				Y		433MHZ
LOTUS	EXIGE	Generation 2/3	01/2008	06/2018	A (LT-1)				Y		433MHZ
MASERATI											
MASERATI	COUPE	M138	01/2007	06/2009	A (MS-1)					Cannot program new sensor	433MHZ
MASERATI	COUPE	M138	07/2009	12/2013	A (MS-1)						433MHZ
MASERATI	GHIBLI	M157	11/2013	06/2018					Y		433MHZ
MASERATI	GRANTURISMO	M145	2008	2010	A (MS-1)					Cannot program new sensor	433MHZ
MASERATI	GRANTURISMO	M145	2011	2013	A (MS-1)						433MHZ
MASERATI	GRANTURISMO SPORT	M145	01/2013	06/2018	A (MS-1)						433MHZ
MASERATI	LEVANTE	M161	05/2016	06/2018					Y		433MHZ
MASERATI	QUATTROPORTE	M139	04/2004	12/2009	A (MS-1)		2			Cannot program new sensor	433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
MASERATI	QUATTROPORTE	M139	01/2010	10/2012	A (MS-1)		2				433MHZ
MASERATI	QUATTROPORTE	M156	01/2013	06/2018					Y		433MHZ
MAYBACH											
MAYBACH	LANDAULET	V240	2009	2014	S (MB-1)					Cannot program new sensor	433MHZ
MAYBACH	MAYBACH 57	W240	10/2002	12/2012	S (MB-1)					Cannot program new sensor	433MHZ
MAYBACH	MAYBACH 62	V240	10/2002	12/2012	S (MB-1)					Cannot program new sensor	433MHZ
MAYBACH	S 500	W221	01/2015	06/2018	A (MB-2)		2		Y		433MHZ
MAZDA											
MAZDA	2	DY/DE/DJ	12/2007	06/2018			2				433MHZ
MAZDA	3	BL/BM BN	06/2009 08/2016	07/2016 06/2018	A (MA-1)						433MHZ
MAZDA	5	CW	01/2010	06/2018	A (MA-1)						433MHZ
MAZDA	6	GH/GJ GL	02/2008 05/2016	04/2016 06/2018	A (MA-1)		2				433MHZ
MAZDA	BT-50	UP/UR/UN	05/2011	06/2018			3				433MHZ
MAZDA	CX3	DJ1	10/2014	06/2018	A(MA-1)						433MHZ
MAZDA	CX5	KE/GH KF	11/2011 06/2017	05/2017 06/2018	A (MA-1)						433MHZ
MAZDA	CX7	ER	10/2009	06/2017	A (MA-1)						433MHZ
MAZDA	CX9	TB1	10/2006	06/2018							433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
MAZDA	MX5	NC/ND	03/2010	06/2018	A (MA-1)						433MHZ
MERCEDES-BENZ											
MERCEDES-BENZ	A-CLASS	W176	01/2014	06/2018	A (MC-1)		1		Y		433MHZ
MERCEDES-BENZ	B-CLASS	W246/W242	01/2014	06/2018	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	AMG	W197	2010	2014	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	AMG E-CLASS	W210	07/1999	03/2002	S					Cannot program new sensor	433MHZ
MERCEDES-BENZ	AMG GT/GT-S	C190	03/2015	06/2018	A				Y		433MHZ
MERCEDES-BENZ	C-CLASS	W204/W203/C204 W205/C205/A205	01/2008 03/2014	02/2014 06/2018	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	CITAN	W415	01/2013	06/2018	A/ O (MC-2)	Y	8				433MHZ
MERCEDES-BENZ	CL-CLASS	C216 C217	06/2009 03/2014	02/2014 06/2018	A (MC-1)		2		Y		433MHZ
MERCEDES-BENZ	CLA	C117	01/2014	06/2018	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	CLC-CLASS	CLC/CL203	06/2008	12/2011	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	CLK	W209/A209/C209	04/2007	09/2009	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	CLS (W219)	W219/C219	10/2004	06/2005	A (MC-1)					Cannot program new sensor	433MHZ
MERCEDES-BENZ	CLS	W219/C219	01/2005	06/2009	A (MC-1)						433MHZ
MERCEDES-BENZ	CLS	C218/W218	07/2009	06/2018	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	E-CLASS	W211	03/2002	06/2005	S		2			Cannot program new sensor	433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
MERCEDES-BENZ	E-CLASS	W211	07/2005	06/2009	A (MC-1)		2				433MHZ
MERCEDES-BENZ	E-CLASS (W212/C207)	W212/C207/A207	07/2009	08/2016	A (MC-1)		1		Y		433MHZ
MERCEDES-BENZ	E-CLASS (W213)	W213	04/2016	06/2018	A						433MHZ
MERCEDES-BENZ	E-CLASS COUPE/CABRIO	C213/A213 C238/A238	03/2017	12/2018	A						433MHZ
MERCEDES-BENZ	G-CLASS	W463	04/2007	06/2018	A (MC-1)		8		Y		433MHZ
MERCEDES-BENZ	GL/GLS-CLASS	X164 X166	06/2009 01/2013	12/2012 06/2018	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	GLA	X156	06/2014	06/2018	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	GLC	C253/X253	01/2015	06/2018	A				Y		433MHZ
MERCEDES-BENZ	GLE	C292/W166	09/2015	06/2018	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	GLK-CLASS	X204	01/2008	09/2015	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	ML-CLASS	W164	07/2005	07/2009	A (MC-1)		1				433MHZ
MERCEDES-BENZ	ML-CLASS	W164 W166	08/2009 06/2011	05/2011 06/2018	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	R-CLASS	W251	01/2006	07/2009	A (MC-1)						433MHZ
MERCEDES-BENZ	R-CLASS	W251	08/2009	11/2017	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	S-CLASS COUPE	C215	07/1999	09/2005	A (MC-1)					Cannot program new sensor	433MHZ
MERCEDES-BENZ	S-CLASS	W220	07/1999	09/2005	A (MC-1)					Cannot program new sensor	433MHZ
MERCEDES-BENZ	S-CLASS	W221	10/2005	05/2009	A (MC-1)		2				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
MERCEDES-BENZ	S-CLASS	W221 W222	06/2009 07/2013	06/2013 06/2018	A (MC-1)		2		Y		433MHZ
MERCEDES-BENZ	SL	R230	06/2005	12/2011	A (MC-1)						433MHZ
MERCEDES-BENZ	SL	R231	01/2012	06/2018	A (MC-4)				Y		433MHZ
MERCEDES-BENZ	SL-ROADSTER	R230	10/2001	05/2005	A (MC-4)					Cannot program new sensor	433MHZ
MERCEDES-BENZ	SLC	R172	01/2016	06/2018	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	SLK	R171/R172	04/2007	12/2015	A (MC-1)		2		Y		433MHZ
MERCEDES-BENZ	SLR	199	04/2004	12/2014	A (MC-1)						433MHZ
MERCEDES-BENZ	SLS	C197/R197	01/2010	06/2017	A (MC-1)				Y		433MHZ
MERCEDES-BENZ	SPRINTER	W906 (NVC3)	06/2006	10/2011	A (MC-3)		2				433MHZ
MERCEDES-BENZ	SPRINTER	W906 (NVC3)	11/2011	06/2018	A (MC-3)		2		Y		433MHZ
MERCEDES-BENZ	V-CLASS	W447	03/2014	06/2018	A (MC-3)				Y		433MHZ
MERCEDES-BENZ	VITO	W639	06/2006	06/2014	A (MC-3)		2				433MHZ
MERCEDES-BENZ	VITO	W447/W640	07/2014	06/2018	A (MC-3)				Y		433MHZ
MERCEDES-BENZ	VIANO	W639	01/2011	05/2014	A (MC-3)		2				433MHZ
MERCEDES-BENZ	X-CLASS	470	12/2017	12/2018	O (MC-2)	Y	3				433MHZ
MINI											
MINI	CABRIO	R57	07/2014	12/2015	A (MN-2)				Y		433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
MINI	CABRIO	F57	01/2016	06/2018	A						433MHZ
MINI	CLUBMAN	R55	10/2007	09/2009	A (MN-2)						433MHZ
MINI	CLUBMAN	F54	07/2014	06/2018	A (MN-2)						433MHZ
MINI	COOPER	R56	09/2007	09/2009	A (MN-2)						433MHZ
MINI	COOPER/MINI	F55/56	01/2014	06/2018	A (MN-2)						433MHZ
MINI	COUNTRYMAN	R60	07/2014	01/2017	A (MN-2)				Y		433MHZ
MINI	COUNTRYMAN	F60	02/2017	06/2018	A (MN-2)						433MHZ
MINI	ONE		01/2017	06/2018	A (MN-2)						433MHZ
MINI	PACEMAN	R61	07/2014	06/2017	A (MN-2)				Y		433MHZ
MINI	ROADSTER	R59	07/2014	08/2015	A (MN-2)				Y		433MHZ
MINI	MINI COUPE	R58	07/2014	06/2017	A (MN-2)				Y		433MHZ
MINI	MINI (HATCH)	R56	2010	2013	A (MN-2)				Y		433MHZ
MITSUBISHI											
MITSUBISHI	ASX	GA0	10/2014	06/2018	O (MI-2)	Y	2				433MHZ
MITSUBISHI	ATTRAGE	A10	10/2014	06/2018	O		2				433MHZ
MITSUBISHI	L200	KA0T/KJ0T	10/2014	06/2018	O (MI-2)						433MHZ
MITSUBISHI	LANCER	CY0	10/2014	11/2017	O (MI-2)	Y	1				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
MITSUBISHI	I-MIEV	HA0/HAV/HA3W	10/2014	06/2018	O (MI-2)		3				433MHZ
MITSUBISHI	MIRAGE	A00	10/2014	06/2018	O (MI-2)	Y	2				433MHZ
MITSUBISHI	OUTLANDER	CW0/GF0	10/2014	06/2018	O (MI-2)	Y	2				433MHZ
MITSUBISHI	PAJERO/SHOGUN/MONTERO	V80	10/2014	06/2018	O (MI-2)	Y	3				433MHZ
MITSUBISHI	SPACESTAR	A00	10/2014	06/2018	O (MI-2)	Y	2				433MHZ
NISSAN											
NISSAN	370Z	Z34	01/2008	06/2014	O (NI-1)	Y	1				433MHZ
NISSAN	370Z	Z34	07/2014	06/2018	O (NI-1)	Y	1				433MHZ
NISSAN	ALMERA	B10	01/2013	06/2018	O (NI-1)		2				433MHZ
NISSAN	B-EV		01/2014	12/2014	O (NI-1)						433MHZ
NISSAN	C-HATCH	C13	10/2014	06/2018	O (NI-1)	Y	1				433MHZ
NISSAN	CUBE	Z12	01/2008	09/2014	O (NI-1)		2				433MHZ
NISSAN	GTR	R35	02/2009	12/2013	O (NI-1)	Y	2				433MHZ
NISSAN	GTR	R35	01/2014	06/2018	O (NI-1)	Y	2				433MHZ
NISSAN	JUKE	F15	06/2010	06/2018	O (NI-1)	Y	1				433MHZ
NISSAN	LEAF	ZE0	05/2014	11/2017	O (NI-1)	Y	2				433MHZ
NISSAN	MICRA	K13	01/2013	06/2014	O (NI-1)		1				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
NISSAN	MICRA	K13	07/2014	03/2017	O (NI-1)	Y	2				433MHZ
NISSAN	MICRA	K14	04/2017	06/2018	A (NI-3)/O (NI-1)	Y					433MHZ
NISSAN	MURANO	Z51	10/2007	05/2014	O (NI-1)		1				433MHZ
NISSAN	MURANO	Z51/Z52	06/2014	06/2018	O (NI-1)	Y	1				433MHZ
NISSAN	NAVARA	D40/D23	10/2004	10/2017	O (NI-1)		1				433MHZ
NISSAN	NOTE	E12	01/2013	06/2018	O (NI-1)	Y	1				433MHZ
NISSAN	NV200	M20	10/2014	07/2015	O (NI-1)	Y					433MHZ
NISSAN	NV200 EV	ME0	04/2014	06/2018	O (NI-1)	Y	2				433MHZ
NISSAN	NV300	J4	11/2016	06/2018	O (RE-1)		2				433MHZ
NISSAN	NV400	X62	06/2014	06/2018	A						433MHZ
NISSAN	QASHQAI	J10/J11	01/2013	06/2018	A/O (NI-1)	Y	2				433MHZ
NISSAN	TIIDA	C11/C13	07/2014	06/2018	O (NI-1)						433MHZ
NISSAN	PATROL	Y62	01/2010	12/2010	O (NI-1)						433MHZ
NISSAN	PRIMERA	P12	01/2002	05/2007	O (NI-1)		1				433MHZ
NISSAN	PULSAR	C13	10/2014	06/2018	O (NI-1)	Y	1				433MHZ
NISSAN	X-TRAIL	T31 T32	01/2013 01/2014	12/2013 08/2016	O (NI-1) O (NI-1)/ A (NI-2)	Y	1				433MHZ
NISSAN	X-TRAIL	T32	09/2016	06/2018	O (NI-1)/ A (NI-2)	Y					433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
OPEL/VAUXHALL											
OPEL/VAUXHALL	ADAM	M-A	01/2012	06/2014	A/O (OP-1)/ S (OP-8)	Y	2		Y		433MHZ
OPEL/VAUXHALL	ADAM	M-A	07/2014	06/2018	O (OP-1)/ S (OP-8)	Y	2				433MHZ
OPEL/VAUXHALL	ADAM S & ROCKS S	M-A	07/2014	06/2018	O (OP-1)/ S (OP-8)	Y	2		Y		433MHZ
OPEL/VAUXHALL	AMPERA	R12	07/2005	12/2015	A (OP-2)/O (OP-1)	Y	1		Y		433MHZ
OPEL/VAUXHALL	AMPERA-E	1G0F	01/2017	06/2018	S (OP-8)						433MHZ
OPEL/VAUXHALL	ANTARA	L-A	08/2006	12/2010	S (OP-7)		2				433MHZ
OPEL/VAUXHALL	ANTARA	L-A	01/2011	05/2014	A		2				433MHZ
OPEL/VAUXHALL	ANTARA	L-A	06/2014	06/2018	S (OP-3)/A						433MHZ
OPEL/VAUXHALL	ASTRA J	P-J	01/2009	05/2014	O (OP-1)	Y	2		Y		433MHZ
OPEL/VAUXHALL	ASTRA J	P-J	06/2014	09/2015	S (OP-3)/O (OP-1)	Y	1		Y		433MHZ
OPEL/VAUXHALL	ASTRA K	B-K	10/2015	06/2018	S (OP-3)/O (OP-1)	Y	2				433MHZ
OPEL/VAUXHALL	ASTRA H	A-H	01/2004	08/2009	S (OP-3)		8				433MHZ
OPEL/VAUXHALL	CASCADA	P-J/SW	01/2013	05/2014	A				Y		433MHZ
OPEL/VAUXHALL	CASCADA	P-J/SW	06/2014	06/2018	O (OP-1)	Y	1		Y		433MHZ
OPEL/VAUXHALL	COMBO D	Combo D	03/2011	06/2018	A				Y		433MHZ
OPEL/VAUXHALL	CORSA D	S07/S-D	01/2006	10/2014	A (OP-5)		6		Y		433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
OPEL/VAUXHALL	CORSA E	X15	11/2014	06/2018	O (OP-1)	Y	2				433MHZ
OPEL/VAUXHALL	CORSA E 1.4 TURBO/OPC	X15	11/2014	06/2018	O (OP-1)	Y	2		Y		433MHZ
OPEL/VAUXHALL	INSIGNIA A	G09	01/2008	04/2014	A (OP-2)		1		Y		433MHZ
OPEL/VAUXHALL	INSIGNIA A	G09	05/2014	05/2017	O (OP-1)/ S (OP-8)	Y	2		Y		433MHZ
OPEL/VAUXHALL	INSIGNIA B	Z18	06/2017	06/2018	A (OP-2)/ O (OP-1)	Y					433MHZ
OPEL/VAUXHALL	KARL/VIVA	D-A	01/2015	06/2018	S (OP-3)/O (OP-1)	Y	2				433MHZ
OPEL/VAUXHALL	MERIVA B	S10	07/2014	06/2017	S (OP-3)		8				433MHZ
OPEL/VAUXHALL	MOKKA	J-A	01/2012	09/2016	S (OP-3)/O (OP-1)	Y	2				433MHZ
OPEL/VAUXHALL	MOKKA X	J-A	10/2016	06/2018	S (OP-3)/O (OP-1)	Y	2				433MHZ
OPEL/VAUXHALL	MOVANO B	X62	01/2010	06/2018	A/O (OP-1)	Y	2				433MHZ
OPEL/VAUXHALL	SIGNUM	Z-C/S	08/2002	08/2009	A (OP-2)						433MHZ
OPEL/VAUXHALL	VECTRA	Z-C/SW	08/2002	08/2008	A (OP-2)		8				433MHZ
OPEL/VAUXHALL	VECTRA ESTATE	Z-C/SW	08/2009	01/2014	A (OP-2)						433MHZ
OPEL/VAUXHALL	VIVARO B	X82/83	03/2014	06/2018	A (OP-6)/O (OP-1)	Y	2				433MHZ
OPEL/VAUXHALL	ZAFIRA B	A-H Monocab	01/2004	12/2013	O (OP-1)						433MHZ
OPEL/VAUXHALL	ZAFIRA B	A-H Monocab	06/2014	12/2014	O (OP-1)				Y		433MHZ
OPEL/VAUXHALL	ZAFIRA C	P12	09/2009	05/2014	O (OP-1)	Y	2		Y		433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
OPEL/VAUXHALL	ZAFIRA C	P12	06/2014	06/2018	O (OP-1)	Y	2		Y		433MHZ
PEUGEOT											
PEUGEOT	1007(KM)	K/KM	01/2005	12/2009	O (PG-1)		2				433MHZ
PEUGEOT	207	W	11/2005	08/2013	O (PG-1)	Y	2				433MHZ
PEUGEOT	207	W	11/2013	06/2015	O (PG-1)	Y	2				433MHZ
PEUGEOT	208	C	2012	2015	O (PG-1)		2				433MHZ
PEUGEOT	2008	C	2013	2015	O (PG-1)	Y	2				433MHZ
PEUGEOT	307	3	01/2004	02/2007	O (PG-1)		8				433MHZ
PEUGEOT	307	3	03/2007	12/2007	O (PG-1)		8				433MHZ
PEUGEOT	308 CC	4	09/2009	08/2013	O (PG-1)	Y	8				433MHZ
PEUGEOT	308 CC	L	11/2013	06/2018	O (PG-1)	Y	8				433MHZ
PEUGEOT	308 SW	4	04/2007	08/2013	O (PG-1)	Y	8				433MHZ
PEUGEOT	3008	0U	11/2008	08/2013	O (PG-1)	Y	2				433MHZ
PEUGEOT	3008	0U	11/2013	06/2018	O (PG-1)	Y	2				433MHZ
PEUGEOT	407(COUPÉ/SW)	6	01/2004	12/2010	O (PG-1)	Y	8				433MHZ
PEUGEOT	408	T73	01/2014	06/2018	O (PG-1)	Y					433MHZ
PEUGEOT	4008	B	06/2014	11/2017	O (PG-4)	Y	2				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
PEUGEOT	508	8	09/2010	08/2013	O (PG-1)	Y	8				433MHZ
PEUGEOT	508	8	11/2013	06/2018	O (PG-1)	Y	1				433MHZ
PEUGEOT	5008	0	09/2009	08/2013	O (PG-1)	Y	2				433MHZ
PEUGEOT	5008	0	11/2013	05/2017	O (PG-1)	Y	1				433MHZ
PEUGEOT	607	9	05/2000	09/2004	O (PG-1)		8				433MHZ
PEUGEOT	607	9	10/2004	09/2010	O (PG-1)		8				433MHZ
PEUGEOT	807	E	06/2002	09/2005	O (PG-1)		1				433MHZ
PEUGEOT	807	E	10/2005	12/2015	O (PG-1)		8				433MHZ
PEUGEOT	BOXER	Y/250	06/2014	06/2018	A (PG-3)		2		Y		433MHZ
PEUGEOT	EXPERT	G9	01/2011	09/2014	O (PG-1)		3				433MHZ
PEUGEOT	EXPERT	G9	10/2014	04/2016	A /O (PG-1)	Y					433MHZ
PEUGEOT	ION	1	01/2014	06/2018			1				433MHZ
PEUGEOT	PARTNER	7/B9	2008	2013	O (PG-1)		3				433MHZ
PEUGEOT	PARTNER	7/B9	01/2014	06/2018	O (PG-1)	Y	3				433MHZ
PEUGEOT	RCZ	4J	03/2010	10/2013	O (PG-1)	Y	8				433MHZ
PEUGEOT	RCZ	4J	11/2013	12/2015	O (PG-1)	Y	8				433MHZ
PORSCHE											

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
PORSCHE	BOXSTER	987	02/2005	10/2008	A (PO-1)						433MHZ
PORSCHE	BOXSTER	987-2	11/2008	12/2011	A						433MHZ
PORSCHE	BOXSTER	981	01/2012	02/2016	A (PO-1)						433MHZ
PORSCHE	BOXSTER (718)	982	03/2016	06/2018	A (PO-1)				Y		433MHZ
PORSCHE	911(997-1 CARRERA)	997	02/2005	03/2008	S						433MHZ
PORSCHE	911(997-2 CARRERA)	997	2009	2011	A (PO-3)						433MHZ
PORSCHE	911(997T-Turbo)	997	2007	2009	S						433MHZ
PORSCHE	911(997T2-Turbo)	997	01/2010	06/2018	S						433MHZ
PORSCHE	918 SPYDER	918	03/2012	12/2016	A						433MHZ
PORSCHE	911(991)	991	01/2012	08/2015	S						433MHZ
PORSCHE	911(991)	991	09/2015	06/2018	A				Y		433MHZ
PORSCHE	997(GT3-2)	P90077	2007	2009	S						433MHZ
PORSCHE	997(GT3-2)	P90107	01/2010	06/2018	A (PO-2)						433MHZ
PORSCHE	CARRERA GT	GT	09/2003	12/2006	S						433MHZ
PORSCHE	CAYENNE	955 - 9PA	12/2002	12/2006	S		2			Cannot program new sensor	433MHZ
PORSCHE	CAYENNE	957-9PA1	2007	2010	S						433MHZ
PORSCHE	CAYENNE	958-92A	01/2011	07/2014	S						433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
PORSCHE	CAYENNE	958-92A PO536	08/2014 08/2017	07/2017 06/2018	A (PO-2)				Y		433MHZ
PORSCHE	CAYMAN	987C	11/2005	12/2008	S						433MHZ
PORSCHE	CAYMAN	987C2	01/2009	04/2014	S						433MHZ
PORSCHE	CAYMAN	981	05/2014	09/2016	A						433MHZ
PORSCHE	CAYMAN (718)	982	10/2016	06/2018	A (PO-1)				Y		433MHZ
PORSCHE	MACAN	95B	01/2014	06/2018	A (PO-1)		2		Y		433MHZ
PORSCHE	PANAMERA	970	09/2009	08/2013	S						433MHZ
PORSCHE	PANAMERA	970 971	09/2013 11/2016	10/2016 06/2018	A (PO-1)				Y		433MHZ
RENAULT											
RENAULT	CAPTUR	R	04/2013	06/2018	O (RE-1)	Y	8				433MHZ
RENAULT	CLIO	R/B	04/2005	05/2014	O (RE-1)		8				433MHZ
RENAULT	CLIO IV	X98	06/2014	06/2018	A (RE-4)/ O (RE-1)	Y	8				433MHZ
RENAULT	ESPACE IV	JK	07/2002	12/2014	O (RE-1)	Y	8				433MHZ
RENAULT	ESPACE V	RFC	01/2015	06/2018	A (RE-2)/O	Y	8				433MHZ
RENAULT	FLUENCE#	L38	02/2010	06/2018	O		8			Use Wireless/Snap-In Sensor	433MHZ
RENAULT	KADJAR	RFE	04/2015	06/2018	A (RE-4)/O	Y	2				433MHZ
RENAULT	KANGOO	W	06/2014	06/2018	O (RE-1)	Y	8				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
RENAULT	KOLEOS	Y	02/2008	12/2013	O		2				433MHZ
RENAULT	KOLEOS	Y	01/2014	05/2017	O (RE-1)	Y					433MHZ
RENAULT	LAGUNA II	X74	12/2000	05/2007	S		8				433MHZ
RENAULT	LAGUNA III#	X91	06/2007	12/2015	A/O (RE-1)	Y	8			Use Wireless/Snap-In Sensor	433MHZ
RENAULT	LATITUDE	T	2011	2015	A/O (RE-1)	Y	8				433MHZ
RENAULT	MASTER	JD	11/2009	06/2018	O (RE-1)	Y	2				433MHZ
RENAULT	MEGANE I	B32/X95	01/1997	08/2002	O (RE-1)		2				433MHZ
RENAULT	MEGANE II	B32	09/2002	12/2007	O (RE-3)	Y	8				433MHZ
RENAULT	MEGANE III#	X95	10/2008	02/2016	O (RE-1)	Y	8				433MHZ
RENAULT	MEGANE IV	RFB	03/2016	06/2018	O (RE-5)	Y	2				433MHZ
RENAULT	MODUS	P	05/2004	12/2012	O (RE-1)		8				433MHZ
RENAULT	SCENIC I	JA	01/2001	05/2003	O (RE-1)		2				433MHZ
RENAULT	SCENIC RX4	JA	01/2001	05/2003	O (RE-1)						433MHZ
RENAULT	SCENIC II	JM	06/2003	01/2009	O (RE-3)	Y	8				433MHZ
RENAULT	SCENIC III#	JZ	01/2009	10/2016	O (RE-1)	Y	8			Use Wireless/Snap-In Sensor	433MHZ
RENAULT	SCENIC IV	RFA	11/2016	06/2018	O (RE-5)	Y	2				433MHZ
RENAULT	SYMBOL/THALIA	L52	04/2013	06/2018	O (RE-1)	Y	9				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
RENAULT	TALISMAN	RFD	02/2016	06/2018	O (RE-5)	Y	2				433MHZ
RENAULT	TRAFIC	X82	03/2014	06/2018	O (RE-1)	Y	2				433MHZ
RENAULT	TWINGO	X44	01/2007	06/2018	O (RE-1)	Y	2				433MHZ
RENAULT	VEL SATIS	J	09/2001	11/2009	O (RE-1)		8				433MHZ
RENAULT	WIND	N	06/2010	12/2016	O	Y	9				433MHZ
RENAULT	ZOE#	AG	09/2012	06/2018	O (RE-1)	Y	8			Use Wireless/Snap-In Sensor	433MHZ
ROLLS ROYCE											
ROLLS ROYCE	CABRIO	Ra67	06/2009	12/2011	A						433MHZ
ROLLS ROYCE	GHOST	RR04	01/2010	06/2018					Y		433MHZ
ROLLS ROYCE	PHANTOM	RR01	09/2007	12/2011	A (RO-1)						433MHZ
ROLLS ROYCE	PHANTOM	RR01	01/2012	11/2016	A (RO-1)				Y		433MHZ
ROLLS ROYCE	WRAITH	RR05	03/2014	06/2018					Y		433MHZ
SAAB											
SAAB	9-3	YS3F	2003	2006	A (SB-1)		3				433MHZ
SAAB	9-3	YS3F	2006	2009	A (SB-1)		3		Y		433MHZ
SAAB	9-3	YS3F	2009	2012	A (SB-1)		3		Y		433MHZ
SAAB	9-4X	S.49	04/2011	01/2014	A (SB-1)						433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
SAAB	9-5	YS3E	2003	2006	A (SB-1)						433MHZ
SAAB	9-5	YS3E	2006	2009	A (SB-1)				Y		433MHZ
SAAB	9-5	YS3G	2009	2012	A (SB-1)				Y		433MHZ
SAAB	9-7X	S.0071	2007	2008	A (SB-2)						433MHZ
SKODA											
SKODA	CITIGO	AA	10/2011	06/2018	A				Y		433MHZ
SKODA	FABIA	NJ	11/2013	06/2018	A		2		Y		433MHZ
SKODA	OCTAVIA	5E	11/2012	06/2018	A		2		Y		433MHZ
SKODA	RAPID	NH	09/2012	06/2018	A		2		Y		433MHZ
SKODA	ROOMSTER	5J	04/2006	12/2015	A		3		Y		433MHZ
SKODA	SUPERB	3T	03/2008	09/2014	A		2		Y		433MHZ
SKODA	YETI	5L	06/2009	06/2018	A		2		Y		433MHZ
SMART											
SMART	FORFOUR	W454/W453	04/2005	06/2018	O (SM-1)	Y	2				433MHZ
SMART	FORTWO	A451/C451	01/2007	02/2014	A (SM-2)		3		Y		433MHZ
SMART	FORTWO	A453/C453	03/2014	06/2018	O (SM-1)	Y	2				433MHZ
SSANGYONG											

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
SSANGYONG	ACTYON	QJ	03/2014	06/2018	A (SS-1)		1		Y		433MHZ
SSANGYONG	KORANDO C	C200	08/2013	06/2018	A (SS-1)		1		Y		433MHZ
SSANGYONG	REXTON	Y300	05/2014	10/2017	A (SS-1)				Y		433MHZ
SSANGYONG	REXTON	Y400	11/2017	06/2018	A (SS-1)				Y		433MHZ
SSANGYONG	RODIUS	AJ	05/2014	06/2018	A (SS-1)				Y		433MHZ
SSANGYONG	TIVOLI/LUVI	X100	06/2015	06/2018	A (SS-1)				Y		433MHZ
SSANGYONG	XLV	XK	06/2016	06/2018	A (SS-1)				Y		433MHZ
SUBARU											
SUBARU	BRZ	ZC	01/2014	06/2018	O (SU-1)	Y			Y		433MHZ
SUBARU	C-CONCEPT	VL9	01/2014	12/2016	O (SU-1)	Y					433MHZ
SUBARU	FORESTER	SJ	01/2014	06/2018	O (SU-1)	Y	2				433MHZ
SUBARU	IMPREZA	GJ/GP/G4	01/2014	12/2017	O (SU-1)	Y					433MHZ
SUBARU	JUSTY	M3	01/2014	12/2015	O (SU-1)	Y					433MHZ
SUBARU	LEGACY	BM/BR/BRS	01/2014	12/2017	O (SU-1)	Y	2				433MHZ
SUBARU	LEVORG	VM	09/2015	06/2018	O (SU-1)	Y	1				433MHZ
SUBARU	OUTBACK	BM/BR/BRS BL/BP/BS/BS9	01/2014 03/2015	02/2015 06/2018	O (SU-1)	Y	2				433MHZ
SUBARU	TREZIA	D1	01/2014	06/2018	S/O (SU-1)	Y					433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
SUBARU	TRIBECA	WX	01/2014	12/2015	S/O (SU-1)	Y					433MHZ
SUBARU	WRX	GJ/GP/G4 V1	01/2014 01/2015	12/2014 06/2018	S/O (SU-1)	Y					433MHZ
SUBARU	XV	GJ/GP/G4	01/2014	08/2017	S/O (SU-1)	Y	2				433MHZ
SUBARU	XV	GK/GT/G5	09/2017	06/2018	O (SU-1)	Y					433MHZ
SUZUKI											
SUZUKI	BALENO	EW	09/2015	06/2018	A/O (SZ-4)	Y					433MHZ
SUZUKI	CELERIO	LF	06/2014	06/2018	O (SZ-4)	Y					433MHZ
SUZUKI	GRAND VITARA	JT	06/2014	06/2018	A/O (SZ-4)	Y					433MHZ
SUZUKI	IGNIS	MF	01/2017	06/2018	A (SZ-5)/O (SZ-4)	Y					433MHZ
SUZUKI	JIMNY	FJ	06/2014	06/2018	O (SZ-4)/S (SZ-3)	Y	2				433MHZ
SUZUKI	KIZASHI	FR	06/2010	12/2017	O (SZ-4)	Y	2				433MHZ
SUZUKI	SWIFT	FZ/NZ AZ	06/2014 05/2017	04/2017 06/2018	O (SZ-4)/S (SZ-3)	Y	3				433MHZ
SUZUKI	SX4 S-CROSS	JY	08/2013	06/2018	O (SZ-4) /S (SZ-2)	Y	2				433MHZ
SUZUKI	VITARA	LY	01/2015	06/2018	A/O (SZ-4)	Y	2				433MHZ
TESLA											
TESLA	MODEL S		01/2013	12/2013	A (TE-2)						433MHZ
TESLA	MODEL S		10/2014	06/2018	A (TE-2)						433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
TESLA	MODEL X		09/2015	06/2018	A (TE-2)						433MHZ
TESLA	ROADSTER		02/2010	09/2012	A (TE-2)						433MHZ
TOYOTA											
TOYOTA	AURIS	E180	01/2014	06/2018	O (TO-1)	Y	2	Y			433MHZ
TOYOTA	AVENSIS	T270	01/2014	06/2018	O (TO-1)	Y	1				433MHZ
TOYOTA	COROLLA	E170	01/2013	06/2018	O (TO-1)	Y	2				433MHZ
TOYOTA	C-HR	X10	01/2017	06/2018	O (TO-1)	Y	2				433MHZ
TOYOTA	GT86	ZN	01/2014	06/2018	O (TO-1)	Y					433MHZ
TOYOTA	LANDCRUISER	J100/J200	2005	2010	O (TO-1)	Y	2				433MHZ
TOYOTA	LANDCRUISER	J200	09/2013	09/2015	O (TO-1)	Y	2		Y		433MHZ
TOYOTA	LANDCRUISER(F.L.)	J200	10/2015	06/2018	O (TO-1)	Y					433MHZ
TOYOTA	PRIUS	XW30/XW50	01/2014	06/2018	O (TO-1)	Y	1				433MHZ
TOYOTA	PROACE	G9	01/2013	05/2014	O (TO-1)						433MHZ
TOYOTA	PROACE	G9	06/2014	04/2016	A/O (TO-1)	Y					433MHZ
TOYOTA	RAV 4	XA30	11/2005	12/2012	O (TO-1)	Y (Unlock Enable)	1				433MHZ
TOYOTA	RAV 4	XA40	01/2013	06/2018	O (TO-1)	Y	1				433MHZ
TOYOTA	VERSO	770L	09/2013	12/2013	O (TO-1)	Y	2				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
TOYOTA	VERSO	ZGR2/AUR2	01/2014	06/2018	O (TO-1)	Y	2				433MHZ
TOYOTA	YARIS	XP130/XP150	01/2014	06/2018	O (TO-1)	Y	1				433MHZ
TIRE INSIGHT											
TIRE INSIGHT	P02-BATTERY TYPE	BP40,BP42	433MHz								433MHZ
TIRE INSIGHT	P03-OTHER RETROFIT	CT60,CP40	433MHz								433MHZ
VOLKSWAGEN											
VOLKSWAGEN	AMAROK		09/2016	06/2018			1		Y		433MHZ
VOLKSWAGEN	ARTEON	3H	06/2017	06/2018	A				Y		433MHZ
VOLKSWAGEN	CC	A6 (35)	01/2012	11/2017	S				Y		433MHZ
VOLKSWAGEN	CRAFTER	2E/2F	04/2006	06/2014	A						433MHZ
VOLKSWAGEN	CRAFTER	2E/2F	07/2014	03/2017	A				Y		433MHZ
VOLKSWAGEN	CRAFTER	7CP	04/2017	06/2018	A				Y		433MHZ
VOLKSWAGEN	JETTA SPORTWAGEN	VW361	2013	2015	A				Y		433MHZ
VOLKSWAGEN	PASSAT	B7	07/2010	08/2014	A (VW-3)				Y		433MHZ
VOLKSWAGEN	PASSAT	B8(3G)	09/2014	06/2018	A (VW-3)				Y		433MHZ
VOLKSWAGEN	PHAETON	3D	06/2002	05/2007	S		2			Cannot program new sensor	433MHZ
VOLKSWAGEN	PHAETON	3D	06/2007	05/2010	S		2				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
VOLKSWAGEN	PHAETON	3D	06/2010	12/2016	S		2				433MHZ
VOLKSWAGEN	TIGUAN	5N	01/2012	12/2015	A (VW-3)		2		Y		433MHZ
VOLKSWAGEN	TIGUAN	5N2	01/2016	06/2018	A (VW-3)		2		Y		433MHZ
VOLKSWAGEN	TOUAREG	7L	11/2002	12/2006	S		2				433MHZ
VOLKSWAGEN	TOUAREG	7L	01/2007	02/2010	S		2				433MHZ
VOLKSWAGEN	TOUAREG	7P	01/2010	05/2014	S						433MHZ
VOLKSWAGEN	TOUAREG	7P	06/2014	06/2018	A (VW-5)				Y		433MHZ
VOLKSWAGEN	TOURAN	5T	09/2015	06/2018	A		1		Y		433MHZ
VOLVO											
VOLVO	C30	M	2007	2013	A (VO-1)		2				433MHZ
VOLVO	C70	M	01/2006	06/2014	A (VO-1)						433MHZ
VOLVO	S40	M	01/2004	06/2014	A (VO-1)		2				433MHZ
VOLVO	S60	R	06/2006	02/2010	A (VO-1)						433MHZ
VOLVO	S60	F	03/2010	06/2014	A (VO-1)						433MHZ
VOLVO	S60	F	07/2014	12/2015	A/O (VO-3)	Y					433MHZ
VOLVO	S80	T/A	03/2006	06/2014	A (VO-1)		2				433MHZ
VOLVO	S80	A	07/2014	08/2016	A		2				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
VOLVO	S90	P	07/2016	06/2018	A (VO-1)		2				433MHZ
VOLVO	V40	M	07/2014	06/2018	A/O (VO-3)	Y	2				433MHZ
VOLVO	V50	M	01/2004	06/2014	A (VO-1)		2				433MHZ
VOLVO	V60	F	11/2010	06/2014	A (VO-1)						433MHZ
VOLVO	V60 HYBRID	F	07/2014	06/2018	A/O (VO-3)	Y	2				433MHZ
VOLVO	V70	S	06/2006	12/2007	A (VO-1)		2				433MHZ
VOLVO	V70	S/B	01/2008	06/2014	A (VO-1)						433MHZ
VOLVO	V70	B	07/2014	06/2016	A/O (VO-3)	Y					433MHZ
VOLVO	V90	P	09/2016	06/2018	A (VO-1)		2				433MHZ
VOLVO	XC60	D	05/2008	06/2014	A (VO-1)						433MHZ
VOLVO	XC60	D	07/2014	12/2016	A						433MHZ
VOLVO	XC70	S	05/2007	12/2007	A (VO-1)		2				433MHZ
VOLVO	XC70	B	01/2008	06/2014	A (VO-1)						433MHZ
VOLVO	XC70	B	07/2014	06/2016	A/O (VO-3)	Y	2				433MHZ
VOLVO	XC90	C	04/2002	12/2014	A (VO-1)						433MHZ
VOLVO	XC90	L	01/2015	06/2018	A (VO-1)/O (VO-3)	Y	2				433MHZ

: If the sensor can't be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.

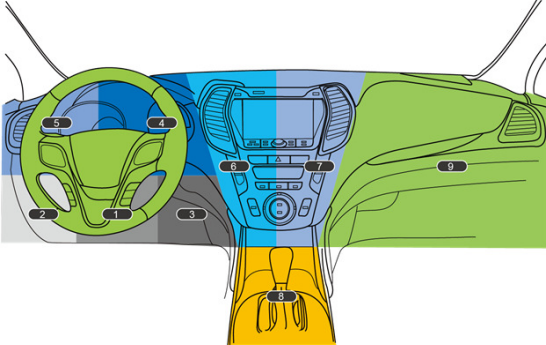
CUB TPMS Application Chart - European Market

MAKE	MODEL	Model code	StartYear	EndYear	Relearn Type (For reference only)	OBD II (CUB Module SUPPORT)	OBD Port Location	Clear TPMS DTC Error Code Function	T.A.L	weak-signal	Type
------	-------	------------	-----------	---------	--------------------------------------	-----------------------------------	----------------------	---	-------	-------------	------

Relearn type:

A:Auto relearn,O:OBDII relearn,S: Stationery relearn

OBD Port Location:

1. Underneath the Steering Wheel, center
 2. Underneath the Steering Wheel, left
 3. Underneath the Steering Wheel, right
 4. On Dashboard, right of steering wheel
 5. On Dashboard, left of steering wheel
 6. On Dashboard central column, left
 7. On Dashboard central column, right side
 8. Underneath the Handrest/ Gear shift area
 9. Inside Drawer
- 

: If the sensor can' t be programmed, please contact your dealer directly.

The Information in this document is believed to be accurate. CUB Incorporated is not responsible for any incorrect information contained in this document.